

**MODEL 2861-XXXX (GTR250)**

We have encountered some situations where the GTR250 seems to have low power. This service bulletin addressed the possible causes, along with the solution to each cause.

Condition: Buggy runs fine, but does not have the power that it should.

HERE ARE A FEW THINGS TO CHECK:

**Possible Problem: Parking Brake too Tight.**

First check the parking brake to see if it is too tight.

Solution – Adjust the parking brake. (See owner manual)

**Possible Problem: Chain is too Tight**

Check the chain adjustment to see if it is too tight.

Solution – Adjust the chain to ¼ free play. (See owners manual)

**Possible Problem: Brake Rotors Dragging**

Inspect the front brake rotors and make sure that they both turn freely with no drag.

Solution – Remove the brake caliper and place one 5/16 washer on each bolt in-between the brake caliper mount and strut.

**Possible Problem: Throttle Cable**

Throttle cable may have too much free-play (not getting full throttle)

Solution – adjust the cable so that it gets full throttle.(see service manual)

NOTE:- MAKE SURE THAT THE TIRE PRESSURE AND THE FRONT END ALIGNMENT IS CORRECT.